




Type 5370

■ Drill chuck adapters for drill chucks with Jacobs taper

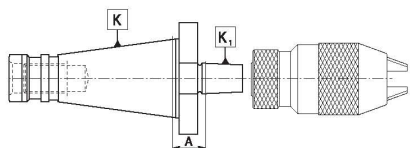


| Code No. | K 7:24 | K1 Jacobs | A |
|-----------|--------|-----------|----|
| 800003406 | 30 | J0 | 12 |
| 800003407 | 30 | J1 | 12 |
| 800003408 | 30 | J2 | 12 |
| 800003409 | 30 | J3 | 12 |
| 800003410 | 30 | J33 | 12 |
| 800003411 | 30 | J6 | 12 |
| 800003412 | 40 | J2 | 14 |
| 800003414 | 40 | J3 | 14 |
| 800003413 | 40 | J33 | 14 |
| 800003415 | 40 | J6 | 14 |
| 800003416 | 50 | J3 | 18 |
| 800003417 | 50 | J33 | 18 |
| 800003418 | 50 | J4 | 18 |
| 800003419 | 50 | J5 | 18 |
| 800003420 | 50 | J6 | 18 |



Type 5370 QC

■ Quick Change
■ Drill chuck adapters for drill chucks taper DIN 238 or Jacobs taper

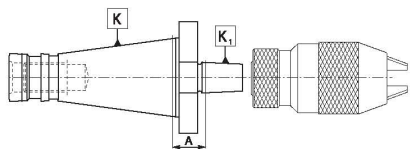


| Code No. | K 7:24 | K1 DIN | A |
|-----------|--------|--------|----|
| 800003421 | 30 | J33 | 21 |
| 800003423 | 30 | J6 | 21 |
| 800003422 | 40 | J33 | 23 |
| 800003424 | 40 | J6 | 23 |

| Code No. | K 7:24 | d | A | | |
|-----------|--------|----|-----|---------|---------|
| 800000914 | 30 | 16 | 200 | 4x4x45 | M16x1,5 |
| 800000915 | 30 | 16 | 250 | 4x4x45 | M16x1,5 |
| 800000916 | 30 | 16 | 315 | 4x4x45 | M16x1,5 |
| 800000917 | 30 | 22 | 200 | 6x6x50 | M20x2 |
| 800000918 | 30 | 22 | 250 | 6x6x50 | M20x2 |
| 800000919 | 30 | 22 | 315 | 6x6x50 | M20x2 |
| 800000920 | 30 | 22 | 400 | 6x6x50 | M20x2 |
| 800000921 | 30 | 27 | 200 | 7x7x50 | M24x2 |
| 800000922 | 30 | 27 | 250 | 7x7x50 | M24x2 |
| 800000923 | 30 | 27 | 315 | 7x7x50 | M24x2 |
| 800000924 | 30 | 27 | 400 | 7x7x50 | M24x2 |
| 800000925 | 40 | 16 | 200 | 4x4x45 | M16x1,5 |
| 800000926 | 40 | 16 | 250 | 4x4x45 | M16x1,5 |
| 800000927 | 40 | 16 | 315 | 4x4x45 | M16x1,5 |
| 800000928 | 40 | 16 | 400 | 4x4x45 | M16x1,5 |
| 800000929 | 40 | 22 | 200 | 6x6x50 | M20x2 |
| 800000930 | 40 | 22 | 250 | 6x6x50 | M20x2 |
| 800000931 | 40 | 22 | 315 | 6x6x50 | M20x2 |
| 800000932 | 40 | 22 | 400 | 6x6x50 | M20x2 |
| 800000933 | 40 | 22 | 500 | 6x6x50 | M20x2 |
| 800000934 | 40 | 27 | 200 | 7x7x50 | M24x2 |
| 800000935 | 40 | 27 | 250 | 7x7x50 | M24x2 |
| 800000936 | 40 | 27 | 315 | 7x7x50 | M24x2 |
| 800000937 | 40 | 27 | 400 | 7x7x50 | M24x2 |
| 800000938 | 40 | 27 | 500 | 7x7x50 | M24x2 |
| 800000939 | 40 | 27 | 630 | 7x7x50 | M24x2 |
| 800000940 | 40 | 32 | 160 | 8x7x63 | M27x2 |
| 800000941 | 40 | 32 | 250 | 8x7x63 | M27x2 |
| 800000942 | 40 | 32 | 315 | 8x7x63 | M27x2 |
| 800000943 | 40 | 32 | 400 | 8x7x63 | M27x2 |
| 800000944 | 40 | 32 | 500 | 8x7x63 | M27x2 |
| 800000945 | 40 | 32 | 630 | 8x7x63 | M27x2 |
| 800000946 | 40 | 40 | 315 | 10x8x63 | M33x2 |
| 800000947 | 40 | 40 | 400 | 10x8x63 | M33x2 |
| 800000948 | 40 | 40 | 500 | 10x8x63 | M33x2 |
| 800000949 | 40 | 40 | 630 | 10x8x63 | M33x2 |
| 800000950 | 50 | 22 | 200 | 6x6x50 | M20x2 |
| 800000951 | 50 | 22 | 250 | 6x6x50 | M20x2 |
| 800000952 | 50 | 22 | 315 | 6x6x50 | M20x2 |
| 800000953 | 50 | 22 | 400 | 6x6x50 | M20x2 |
| 800000954 | 50 | 22 | 500 | 6x6x50 | M20x2 |
| 800000955 | 50 | 22 | 630 | 6x6x50 | M20x2 |
| 800000956 | 50 | 27 | 315 | 7x7x50 | M24x2 |

Type 7175

■ Milling machine arbors

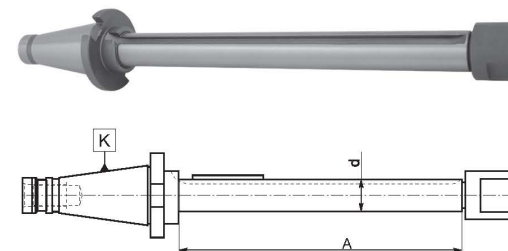

| Code No. | K 7:24 | d | A | | |
|-----------|--------|----|------|---------|-------|
| 800000957 | 50 | 27 | 400 | 7x7x50 | M24x2 |
| 800000958 | 50 | 27 | 500 | 7x7x50 | M24x2 |
| 800000959 | 50 | 27 | 630 | 7x7x50 | M24x2 |
| 800000960 | 50 | 27 | 800 | 7x7x50 | M24x2 |
| 800000961 | 50 | 32 | 315 | 8x7x63 | M27x2 |
| 800000962 | 50 | 32 | 400 | 8x7x63 | M27x2 |
| 800000963 | 50 | 32 | 500 | 8x7x63 | M27x2 |
| 800000964 | 50 | 32 | 630 | 8x7x63 | M27x2 |
| 800000965 | 50 | 32 | 800 | 8x7x63 | M27x2 |
| 800000966 | 50 | 32 | 900 | 8x7x63 | M27x2 |
| 800003425 | 50 | 32 | 1000 | 8x7x63 | M27x2 |
| 800000968 | 50 | 40 | 400 | 10x8x63 | M33x3 |
| 800000969 | 50 | 40 | 500 | 10x8x63 | M33x3 |
| 800000970 | 50 | 40 | 630 | 10x8x63 | M33x3 |
| 800000971 | 50 | 40 | 800 | 10x8x63 | M33x3 |
| 800000972 | 50 | 40 | 900 | 10x8x63 | M33x3 |
| 800000967 | 50 | 40 | 1000 | 10x8x63 | M33x3 |
| 800000974 | 50 | 50 | 400 | 12x8x80 | M39x3 |
| 800000975 | 50 | 50 | 500 | 12x8x80 | M39x3 |
| 800000976 | 50 | 50 | 630 | 12x8x80 | M39x3 |
| 800000977 | 50 | 50 | 800 | 12x8x80 | M39x3 |
| 800000978 | 50 | 50 | 900 | 12x8x80 | M39x3 |
| 800000973 | 50 | 50 | 1000 | 12x8x80 | M39x3 |
| 800000979 | 50 | 60 | 630 | 14x9x80 | M45x3 |
| 800000980 | 50 | 60 | 800 | 14x9x80 | M45x3 |
| 800000981 | 50 | 60 | 900 | 14x9x80 | M45x3 |
| 800000982 | 50 | 60 | 1000 | 14x9x80 | M45x3 |

- 1
- 2
- 3
- 4
- 5
- 6

- 7175
5370
5370 QC